

# Manhole Inspection Summary

Manhole # S29UU1022MH

Printed On: 12/17/2008

Page 1 of 5

**Inspection** ☐ Is Incomplete Rating: **4) Poor**

Record Plat: **29UU1** Node: **022** Status: **Found**

Insp Date: **1/10/07 2:34 PM**

Incomplete Comments

Crew: **JY, DP**  
Inspector: **Yi, J**  
Firm: **RKK**

**Location** Address: **308 WYNDHURST AVE**

Cross Street: **LAWNDALE AVE**

**Manhole** Type: **Inline** Location: **Roadway** Ground Conditions: **Dry**

☐ Prev. Rehab Weather: **Dry** Subject To Ponding: **None**

Comments **This MH has 3 in pipes and 1 out pipe - 2 of 3 In pipes, which are not on the map, are plugged. There is inflow through the plugged pipes and its pipe seals.**

**Cover** Shape: **Circular** Diameter: **24** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary** Condition: **Sound** Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **2** (in.) Condition: ☐ Sound ☐ Cracked ☒ **Leaks**

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **9** (in.)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☒ **Mortar** ☐ Roots ☐ Wall

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Circular** Diameter: **48** (in.) Length: (in.)

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☐ Joint ☐ Cracks ☒ **Mortar** ☐ Roots ☒ **Wall**

**Bench** ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged ☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☐ Root Intrusion ☒ **Deteriorated** ☐ Leaks ☐ Debris

**Steps** Count: **11** Missing: **0** ☐ Corroded

**Surcharge** ☐ Evidence Of Surcharge Depth: (ft.) ☐ Active Surcharge Present

Location View



Top View



Bench debris.

Inside the I4



Plugged/Roots

Inside the I9



Plugged/Roots. Inflow

Defect



Adjustment infiltration.

Defect



Barrel deterioration and infiltration.

Defect



Barrel infiltration.


## Manhole Inspection Summary

Manhole # S29UU1022MH

Printed On: 12/17/2008

Page 4 of 5

### 18 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock

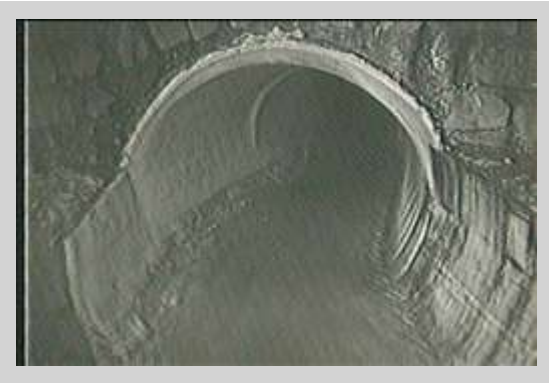

Barrel deterioration and infiltration.

Rod and Bar (Angled)

Pipe Material: **Unknown** ☒ Pipe Lined

Invert Depth: **16.93** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Cracked**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer Pipe In @ 4 O'Clock



Channel deterioration. Plugged - Inflow.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **15.92** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Weeper** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Stub connection / abandoned**

☐ Possible Illicit Connection

## Manhole Inspection Summary

Manhole # S29UU1022MH

Printed On: 12/17/2008

Page 5 of 5

### 18 in. Circular Gravity Sewer

Pipe In @ 5 O'Clock



Rod and Bar (Angled)

Pipe Material: **Unknown** ☒ Pipe Lined

Invert Depth: **16.81** (ft.) Flow Characteristics: **Fast**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 8 in. Circular Gravity Sewer

Pipe In @ 9 O'Clock



Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **15.97** (ft.) Flow Characteristics: **None**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Weeper** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Stub connection / abandoned**

☐ Possible Illicit Connection